# OMRON

## 形 ZS-LD15G/LD15GT

スマートセンサ 形ZS-LDC□□用 センサヘッド

## 取扱説明書

このたびは、本製品をお買い上げいただきまして、まことにありがとうございま す。ご使用に際しては、次の内容をお守りください。

- ・電気の知識を有する専門家が扱ってください。
- ・この取扱説明書をよくお読みになり、十分にご理解のうえ、正しくご使用く
- ・この取扱説明書はいつでも参照できるように大切に保管ください。

### ■輸出貿易管理令について

形ZS-LD15Gは海外為替および外国貿易管理法の規定により、輸出許可取得 対象貨物(または技術)に該当します。日本国外に持ち出す際には、日本国政府の 輸出許可申請等、必要な手続きをお取りください。

\*貴社担当オムロン営業員にお問い合わせください。





## オムロン株式会社

© OMRON Corporation 2005 All Rights Reserved.

## 安全上のご注意

### ●警告表示の意味



正しい取扱いをしなければ、この危険のために、軽傷・中程度の 傷害を負ったり、万一の場合には重症や死亡にいたる恐れがあ ります。また、同様に重大な物的損害をもたらす恐れがあります。

## ●図記号の説明



●レーザ光線

レーザ光線の危険の可能性を注意する通告に用いる。



機器を分解することで感電などの障害が起こる可能性があ る場合の禁止通告に用いる。

## ●警告表示

レーザ光を見つづけると視力障害を起こします。 決してビームをのぞき込まないでください。



分解すると、レーザ光がもれ出し視力障害を起こす恐れ があります。 分解しないでください。



## 安全上の要点

以下に示すような項目は安全を確保する上で必要なことですので必ず守ってください。

- 1. 引火性、爆発性ガスの環境では使用しないでください。
- 2. この製品は分解したり、修理、改造をしないでください。
- 3. ロック機構のあるものは必ずロックしていることを確認してからご使用ください。
- 4. 廃棄するときは、産業廃棄物として処理してください。

## 使用上の注意

- 1. 下記の設置場所では使用しないでください。
  - ・ 強い外乱光(レーザ光、アーク溶接光など)や強い電磁界のある場所
  - センサヘッド前面のフイルタに塵埃、油滴、結露が付着する恐れのある場所
  - 腐食性ガスのある場所
  - ・ 本体に直接振動や衝撃が伝わる場所
- 2. 取付けの前にご確認ください。
  - 対象物の材質・形状によって測定できない場合や精度がでない場合があります。 (透明体、反射率の極端に小さな部材、スポット径よりも小さな対象物、曲率の大きな対 象物、大きく傾斜した対象物など)
- 3. 配線について
- ・ センサヘッド・センサコントローラ間のコードは、高圧線、動力線との接近を避けて配線し てください。同一配線あるいは同一ダクトにすると誘導を受け、誤動作あるいは破損の 原因になることがあります。
- センサヘッドの着脱は、必ずセンサコントローラの電源を切った状態で行ってください。 電源ONのまま行うと故障の原因になります。
- 4. 清掃について
- シンナー、ベンゼン、アセトン、灯油類はセンサヘッド表面を溶かしますので、避けてください。
- ・ 塵埃の除去にはカメラレンズ用ブロアブラシで吹き飛ばしてください。
- 取れにくい汚れには柔らかい布にアルコールを少量含ませて、ていねいに拭き取って ください。
- 5. 互換性について
  - ・センサヘッドとセンサコントローラは互換性があり、別々にお求めいただいてもご使用できます。

## レーザ安全について

#### ■取扱い上の注意

■定格/性能

検出中心距離

ビーム径(\*1)

分解能(\*3)

温度特性(\*4)

LED表示灯

使用周囲照度

周囲温度

周囲湿度

絶縁抵抗

振動(耐久)

衝撃(耐久)

耐電圧 保護構造

コード長

材質

質量

付属品

サンプリング周期(\*5)

リニアリティ (\*2)

測定モード

測定範囲

光源

形式

・形ZS-LD15G/LD15GTは可視光レーザを放射しています。直接見つめないでくだ さい。レーザビームの光路を終端するようにご使用ください。

終端材は反射の少ないつや消し塗装面が最適です。

NFAR灯

FAR灯

光路に鏡面反射体がある場合は、反射光路に対してビームを閉じこめるようにしてくださ い。解放して使用しなければならない場合、光路は目の高さを避けるようにしてください。

■レーザ機器に関しては使用される国によってレーザ安全対策が規定されています。 国内で使用される場合、海外で使用される場合にわけて説明します。

JIS C6802:2014規格で、レーザ製品のクラスに応じて使用者が行わなければならない 安全予防対策が規定されています。

形ZS-LD15G/LD15GTは、本規格に定めるクラス1に分類されます。

#### レーザに関するラベル表示

センサヘッド側面に下図の説明ラベルが貼られています。



※取付けによりラベルが隠れる場合は付属品の和文ラベルを見える位置に 貼ってください。

#### (2)米国

本製品は、米国のレーザ規制FDA(Food and Drug Administration の規制)を受けます。 形ZS-LD15G/LD15GTはCDRH(Center for Devices and Radiological Health)に届 け出予定です。外国への輸出など詳細についてはお問い合わせください。

#### (3)中国

形ZS-LD15G

測定範囲外、または受光量過不足の場合、フラッシング

測定範囲外、または受光量過不足の場合、フラッシング

動作時・保存時:35% to 85% RH (ただし、結露しないこと)

10~150 Hz, (複振幅0.7mm) X,Y,Z 各方向 80min

動作時:0 to +50℃. 保存時: -15 to +60℃

150m/s², 6方向 各3回(上下、左右、前後)

ケース:アルミダイキャスト 全面カバー:ガラス

測定中心距離付近、および測定範囲内の測定中心距離より近側で点灯

測定中心距離付近、および測定範囲内の測定中心距離より遠側で点灯

レーザ安全説明ラベル(JIS・EN 各1枚)、フェアライトコア(2個)、インシュロック(2個)

 $0.15 \mu m (0.001 \mu m)$ 

形ZS-LD15G/LD15GTは、GB7247.1:2012規格に定めるClass1に分類されます。 (1类激光产品)

#### (4)日本、米国、中国を除く諸外国

国内、米国および中国以外の地域については、説明ラベルを付属の英文ラベルに張り

形ZS-LD15G/LD15GTはIEC 60825-1:2014 / EN 60825-1:2014規格でクラス1 に分類されます。

形ZS-LD15GT

0.25µm



正反射

15mm

約25 ×900µm

+0.1%F.S

110µs


0.04%F.S./°C

±0.75mm

可視半導体レーザ(波長650nm、1mW以下、JISクラス1)

### ■フェライトコアの装着


センサヘッドのケーブルの両端に、フェライトコア(センサヘッドの付属品)を装着してください。 フェライトコアがずれる場合は、付属のインシュロックにより固定してください。

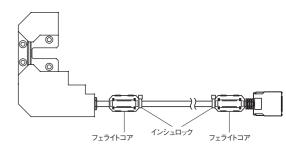

## ■外形寸法

形ZS-LD15G/LD15GT

(単位:mm)

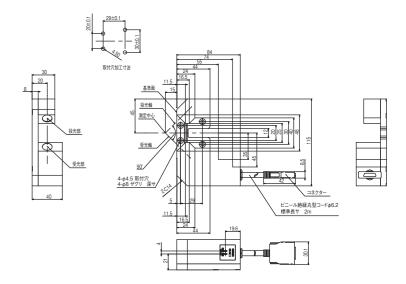

## ご承諾事項

当社商品は、一般工業製品向けの汎用品として設計製造されています。従いまして、次に 掲げる用途での使用を意図しておらず、お客様が当社商品をこれらの用途に使用される際 には、当社は当社商品に対して一切保証をいたしません。ただし、次に掲げる用途であって も当社の意図した特別な商品用途の場合や特別の合意がある場合は除きます。

- (a) 高い安全性が必要とされる用途(例:原子力制御設備、燃焼設備、航空・宇宙設備、鉄 道設備、昇降設備、娯楽設備、医用機器、安全装置、その他生命・身体に危険が及び
- (b) 高い信頼性が必要な用途(例:ガス・水道・電気等の供給システム、24時間連続運転 システム、決済システムほか権利・財産を取扱う用途など)
- (c) 厳しい条件または環境での用途(例:屋外に設置する設備、化学的汚染を被る設備 電磁的妨害を被る設備、振動・衝撃を受ける設備など)
- (d) カタログ等に記載のない条件や環境での用途

\*(a)から(d)に記載されている他、本カタログ等記載の商品は自動車(二輪車含む。以下同 じ)向けではありません。自動車に搭載する用途には利用しないで下さい。自動車搭載 用商品については当社営業担当者にご相談ください。

\*上記は適合用途の条件の一部です。当社のベスト、総合カタログ、データシート等最新版 のカタログ、マニュアルに記載の保証・免責事項の内容をよく読んでご使用ください。

## オムロン株式会社 インダストリアルオートメーションビシネスカンパニー

●製品に関するお問い合わせ先 お客様相談室

**国端0120-919-066** 

携帯電話・PHS・IP電話などではご利用いただけませんので、下記の電話番号へおかけください。

雷話 055-982-5015(通話料がかかります)

■営業時間:8:00~21:00 ■営業日:365日

●FAXやWebページでもお問い合わせいただけます。

FAX 055-982-5051 / www.fa.omron.co.ip

●その他のお問い合わせ

納期・価格・サンプル・仕様書は貴社のお取引先、または貴社 担当オムロン販売員にご相談ください。

オムロン制御機器販売店やオムロン販売拠点は、Webページで ご案内しています。

A(V) 2014年7月

\*1.測定中心距離の値(実力値)で、中心光強度の1/e<sup>2</sup>(13.5%)で定義しています。定義域外にも漏れ光があり、ワーク周囲の光反射率がワークに比べて高い状況では、影響の出る場合があります。 \*2.測定値における理想直線に対する誤差。ワークはガラス。ワークによって直線性が変わることがあります。 \*3.平均回数128回、高精度モードに設定した場合の測定中心距離における変位出力の「ピーク to ピーク」の変位換算値。ワークはガラス。 ( )内は平均回数4096回に設定し、USBまたはRS-232Cからデータを取込んだ場合の代表例。

3000 lx 以下 (白熱ランプ)

(ただし、結露・氷結しないこと)

20MΩ(DC500Vメガにて)

IP40

約400 g

AC1000V 50/60 Hz 1 min.

\*4.センサヘッドとワークの間をアルミ治具で固定した場合の測定中心距離における温度特性の代表値

\*5.高速モード設定時。

# OMRON

## Model ZS-LD15G/LD15GT

Sensor Head for Smart Sensor ZS-LDC

## **INSTRUCTION SHEET**

Thank you for selecting OMRON product. This sheet primarily describes precautions required in installing and operating the product. Before operating the product, read the sheet thoroughly to acquire sufficient knowledge of the product. For your convenience, keep the sheet at your disposal.

#### **■**Export and Trade Control Laws

The ZS-LD15G is classed as a commodity (or technology) requiring acquisition of export permission in accordance with foreign exchange and overseas trade control laws. When the LD15G is to be taken outside of Japan, adopt the required procedures such as application for export permission by the Japanese government.

\* Contact your OMRON representative.



© OMRON Corporation 2005 All Rights Reserved.

## **PRECAUTIONS ON SAFETY**

#### Meanings of Signal Words



ndicates a potentially hazardous situation which, if not avoided, will result in minor or moderate injury. or may result in serious injury or death. Additionally, there may be significant property damage.

### Meaning of Alert Symbols



Indicates the possibility of laser radiation.



Indicates prohibition when there is a risk of minor injury from electrical shock or other source if the product is disassembled.

#### Alert Statements in this Sheet

## **⚠** WARNING

Never look into the laser beam Doing so continuously will result in visual impairment.



Do not disassemble the product. Doing so may cause the laser beam to leak, resulting in the danger of visual impairment.



## PRECAUTIONS FOR SAFE USE

Please observe the following precautions for safe use of the product:

- 1. Do not use the product in environments where it can be exposed to inflammable/explosive gas.
- 2. Do not disassemble, repair or modify this product.
- 3. Be sure to make sure that locking mechanisms are locked before use.
- 4. Dispose of this product as industrial waste.

## PRECAUTIONS FOR CORRECT USE

- 1. Do not install the product in locations subjected to the following conditions: Reflection of intense light (such as other laser beams or electric arc-welding
- · Presence of dust, oil droplets or spray on the filter on the front of the Sensor Head
- · Presence of corrosive or flammable gases
- · Direct vibration or shock
- 2. Pre-installation Checks
  - · The product cannot accurately measure the following types of objects: (transparent objects, objects having an extremely low reflection factor, objects smaller than the spot diameter, objects with a large curvature, excessively inclined objects, etc.)

#### 3. Wiring

- · Avoid wiring the cable between the Sensor Head and Sensor Controller including this product near high voltage lines and power lines. Wiring them together or placing them in the same duct may cause induction, resulting in malfunction or damage.
- Before connecting/disconnecting the Sensor Head, make sure that the Smart Sensor is turned OFF. The Smart Sensor may break down if the Sensor Head is connected or disconnected while the power is ON.

#### 4. Cleaning

- Do not use paint thinner, benzene, acetone or kerosene to clean the Sensor Head. Doing so will melt the surface of the Sensor Head.
- · To remove dust particles, use a blower brush.
- · To remove stubborn dirt, wipe gently with a soft cloth moistened with a small amount of alcohol.

#### Compatibility

The Sensor Head is compatible with the Sensor Controller, and can be used if purchased separately.

## LASER SAFETY

## ■ Handling Precautions

Specifications

Measuring Center distance

Temperature characteristic (\*4)

Operating ambient illumination

Dielectric strength(destructive)

Vibration esistance(destructive)

Shock resistance(destruction)

Ambient temperature

Insulation resistance

Degree of protection

Ambient humidity

Model Item

Optical system

Measuring range

Beam diameter (\*1)

Sampling cycle(\*5)

Light source

Linearity(\*2)

Indicators

Resolution(\*3)

- The ZS-LD15G/LD15GT emits a visible laser beam. Do not stare directly into the laser. Make sure that the laser beam path is terminated A non-reflective matte painted surface is ideal at the end of the laser beam path.
- If specular objects are present in the laser beam path, make sure that they are prevented from reflecting the laser beam. When used without an enclosure, make sure the laser path from eye level is avoided.
- Laser safety measures for laser devices are stipulated both in Japan and overseas. Here, four cases are described

NEAR indicator

FAR indicator

\*5 This value is obtained when the measuring mode is set to the high speed mode.

#### (1) Usage in Japan

The JIS C6802:2014 standard stipulates the safety precautions that users must take according to the class of the laser product. The ZS-LD15G/LD15GT is classified into class 1 defined by this standard. labeling on Laser Use

The ZS-LD15G/LD15GT has the following warning label on the side of the



#### (2) USA

When using devices in which this product is installed in U.S., the devices are subjected to the U.S. FDA (Food and Drug Administration) laser regulations. The ZS-LD15G/LD15GT is scheduled to by registered to CDRH (Center for Device and Radiological Health).

Please inquire details like export to foreign country.

#### (3) China

The ZS-LD15G/LD15GT is classified into Class 1 by the GB7247.1:2012 standard. (1类激光产品)

(4) For countries other than Japan, U.S. and China

Regular reflection

15mm

25 ×900μm

+0.1%F.S

110*u*s

0.04%F.S./°C

Lit near measuring center distance, and nearer than measuring center distance inside the measuring range Blinks when the measurement target is outside of the measuring range or when

Lit near measuring center distance, and further than measuring center distance inside the

0.5m . 2m

Illumination on received light surface 3000 lx or less (incandescentlight)

10 to 150 Hz, 0.7-mm double amplitude 80 min each in X,Y and Z directions

Operating and storage: 35% to 85% RH (with no condensation)

measuring range Blinks when the measurement target is outside of the measuring range or when

Visible semiconductor laser(wavelength 650nm,1mW max.,Class 1)

±0.75mm

When Usage in countries other than Japan, U.S. and China, the ZS-LD15G/LD15GT is classified into Class 1 by the IEC 60825-1:2014 / EN 60825-1:2014 standard. When Usage of ZS-LD15G/LD15GT in countries other than Japan, U.S. and China, replace the explanatory label with corresponding English label.




ZS-LD15GT

0.25µm

### Attaching the ferrite core


Attach the ferrite core (provided with the Sensor Head) to both ends of the Sensor

If the ferrite core comes loose from the cable, fasten the ferrite core in place with the Insure Lock (supplied).

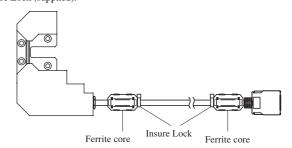

## Dimensions

## ZS-LD15G/LD15GT

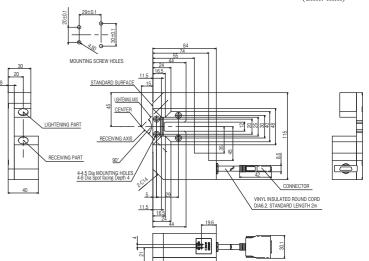

## Suitability for Use

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL **FOUIPMENT OR SYSTEM** 

#### OMRON Corporation **Industrial Automation Company** Contact: www.ia.omron.com

#### Regional Headquarters OMRON EUROPE B.V.

Wegalaan 67-69, 2132 JD Hoofddorp

The Netherlands Tel: (31)2356-81-300/Fax: (31)2356-81-388

■ OMRON ELECTRONICS LLC

## 2895 Greenspoint Parkway, Suite 200

Hoffman Estates II 60169 U.S.A. Tel: (1) 847-843-7900/Fax: (1) 847-843-7787

MRON ASIA PACIFIC PTE. LTD.

#### No. 438A Alexandra Road # 05-05/08 (Lobby 2), Alexandra Technopark. Singapore 119967

Tel: (65) 6835-3011/Fax: (65) 6835-2711

## OMRON (CHINA) CO., LTD.

Room 2211, Bank of China Tower 200 Yin Cheng Zhong Road. PuDong New Area, Shanghai, 200120, China Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200

D(t) Jun, 2019

#### Cable length Case:aluminum die-cast, front cover: glass Materials Weight Approx. 400 g Laser label(1 each for JIS/EN), Ferrite core(2 pcs), Insure Lock(2 pcs) Accessories \*1 Defined as 1/e2 (13.5 %) of the center optical intensity in the measurement center distance (effective value). The beam diameter is sometimes influenced by the ambient conditions of the workpiece such as leaked light from the main beam. \*2 This is the error on the measured value with respect to an ideal straight line. The standard workpiece is glass. Linearity may change according to the workpiece \*3 This is the "peak-to-peak" displacement conversion value of the displacement output in the measuring center distance when the number of samples to average is set to 128, and the measuring mode is set to high-resolution mode. The standard workpiece is glass. Figures in parentheses ( ) are set to the average count 4096, or typical values when data is loaded from the USB or RS-232C interface the standard

150m/s<sup>2</sup>, for 3 times each in X,Y and Z directions

ZS-LD15G

 $0.15 \mu m (0.001 \mu m)$ 

the received light amount is insufficient

the received light amount is insufficient

(with no icing or condensation)

AC1000V 50/60 Hz 1 min.

20MΩ(500mVDC)

\*4 This is the typical value obtained in the measuring center distance when the sensor and workpiece are fixed by an aluminum tool.

Operating:0 to +50°C, Storage: -15 to +60°C